

[BMW F10 535i xDrive Sedan](#) / [Repair Manuals and Technical Data](#) / [51 Body equipment](#) / [51 45 Trim, instrument trim panel](#) /

## 51 16 163 Removing and installing/replacing rear centre console cover




### Necessary preliminary tasks:

- Release [cover on centre console at side](#) left and right in rear area



When working on trim panel components, make sure that visible surfaces are not scratched or damaged (e.g. by sharp-edged tools).

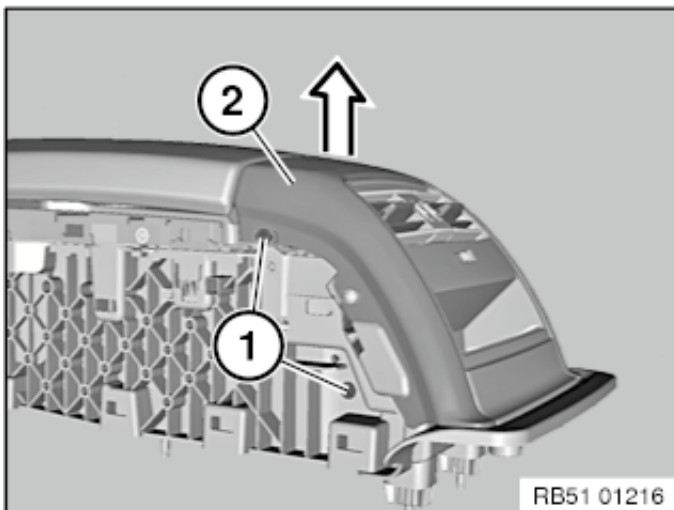


Open centre armrests.

Release screws (1).

Disengage rear centre console cover (2) in direction of arrow.

If necessary, unlock plug connections and disconnect.

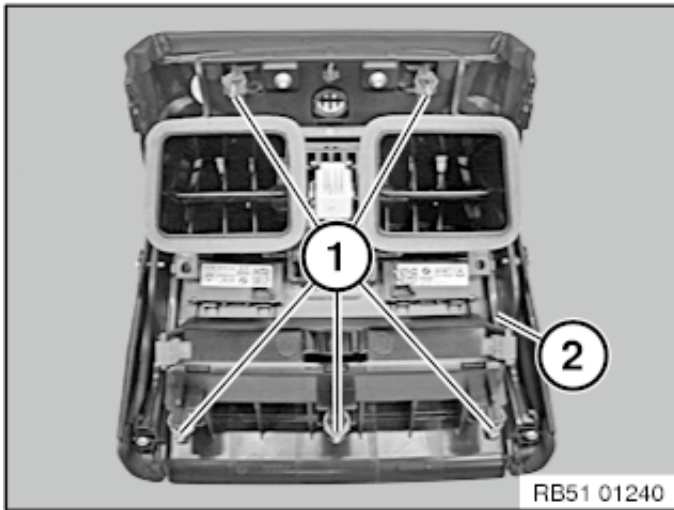***Installation note:***

Retaining clips (1) of rear centre console cover (2) must not be damaged or missing.

**Replacement**

- [Modify fresh air grille](#)

For informational purposes only. The information on this website is provided AS-IS with no warranties, express or implied, and is not guaranteed to be error-free, up-to-date or complete. NewTIS and BMW assume no liability for any loss or damage arising from the use or reliance on the information and content on this website. The content on this website is subject to change without notice.